



National Transportation Safety Board Aviation Accident Factual Report

Location:	VAN NUYS, CA	Accident Number:	LAX99TA066
Date & Time:	01/02/1999, 2115 PST	Registration:	N58126
Aircraft:	Bell 205A-1	Aircraft Damage:	Substantial
Defining Event:		Injuries:	1 Serious, 2 None

Flight Conducted Under: Part 91: General Aviation - Public Aircraft

On January 2, 1999, at 2115 hours Pacific standard time, a Bell 205A-1, N58126, landed hard during a autorotation in Rustic Canyon, about 7 miles southwest of the Van Nuys, California, airport. The forced landing was precipitated by a loss of engine power during a climb following takeoff. The aircraft sustained substantial damage. The commercial pilot and one crewmember were not injured. The other crewmember sustained serious injuries. The public-use helicopter was being operated by the Los Angeles City Fire Department as a training flight at the time of the accident. The flight originated at the Van Nuys Airport about 2000, and a company visual flight rules (VFR) flight plan was on file. Night visual meteorological conditions prevailed.

The pilot reported that the purpose of the flight was to practice "Night-Sun" operations. After 1 hour of training the pilot landed the helicopter on a dirt road so the crewmembers could switch seats. He reported that after conducting a crew briefing, he lifted off and began a climb to the north. The pilot stated that approximately 10 to 15 seconds later, and about 75 feet agl, he initiated a left turn to the west. He reported that almost immediately after beginning the turn he heard a loud "clunking" sound, which was accompanied by vibrations. The engine then emitted a loud grinding, metallic grating sound. Simultaneously, warning lights, engine chip lights, and the rpm decay light became illuminated. The pilot reported that he immediately lowered the collective and entered an autorotation. He stated that he did not have sufficient airspeed and altitude to reach the dirt road, so he started a 180-degree left turn down the canyon. He informed the crew that they had an engine failure and would be going to the bottom of the canyon. The pilot reported that after reaching treetop level, he performed a hard flare and near-vertical descent with little forward speed. The helicopter landed hard and came to rest on rough uneven terrain surrounded by trees and high vegetation.

The pilot reported that after egress of the aircraft, he did not smell or see smoke, nor did he note any fuel leakage. He further stated that the engine and rotor blades were stopped. The pilot reported that he had not experienced any mechanical abnormalities with the aircraft prior to the onset of the engine problem.

The helicopter was recovered from the site with a hoist assembly and was examined on January

7, 1999 by the Safety Board with technical assistance from Bell Helicopters and Allied Signal. Examination of the airframe revealed that the main cabin assembly was intact. The belly of the aircraft exhibited dents and crushing damage. The cockpit area and flight controls appeared undamaged. The pilot's seat appeared to be bent downward approximately 1 inch at the forward edge. The copilot's seat appeared undamaged.

The main rotor mast and controls had been removed from the transmission. The transmission was still mounted to the airframe and it was noted that the transmission input quill rotated freely in the freewheel direction (counter-clockwise) but would not rotate in the drive direction. The main driveshaft was intact.

The tailboom was intact but had been removed from the fuselage. The upper right tailboom attachment fitting displayed a fracture; the fractured portion remained attached to the tailboom assembly. A portion of the fuselage mounted tailboom attachment fitting was present at the upper right-side corner of the forward bulkhead of the tailboom. The right-side synchronized elevator assembly was damaged and had been pushed aft in the tailboom structure. The tail rotor assembly was still mounted to the top of the vertical fin. Drive and control continuity was established from the fuselage aft to the tail rotor assembly. One tail rotor blade exhibited a cut approximately 1/16 inch wide and 3/4 inch deep in the leading edge.

The engine was still attached to the airframe. Both legs of the engine mount bipod on the right side of the engine were bent aft. The forward and inner legs of the engine mount were also bent. The engine controls and accessories remained intact. The engine power turbine as viewed from the exhaust exhibited damage. The number 4 turbine wheel was missing all of its blades and the blades on the number 3 turbine wheel were damaged. Scoring was evidenced on the inside diameter of the turbine case in the area of the Nos. 3 and 4 turbine wheels. The engine was removed from the airframe and shipped to Allied Signal Corporation for further testing.

The engine was examined on January 25 and 26, 1999, under the supervision of the Safety Board. Disassembly of the engine revealed that all the vanes and inner and outer supports of the second stage power turbine nozzle were displaced and/or missing, and fragments of the outer vane support were torn and distorted. The third stage turbine nozzle exhibited extensive damage on the trailing edges of the vanes and on the shroud/outer housing. The Allied Signal metallurgist reported that this damage was indicative of secondary damage resulting from the separations of the third stage blades and the fourth stage nozzle. Almost all of the fourth stage turbine nozzle was missing, except for portions of the outer band. The metallurgist was not able to determine the exact cause of the damage; however, he noted that the remaining features on the fourth stage nozzle were indicative of an overload fracture mode.

He further concluded that the separations of the blades on both the third and fourth stage turbine wheel assemblies were indicative of an overload fracture mode. No material defects or fatigue cracks were observed on the overload fractures.

The metallurgist concluded that the overall type and degree of engine damage was indicative of

a component failure in the second stage power turbine nozzle area; however, the cause of the component failure was not determined. All other damage observed was concluded to be secondary.

Pilot Information

Certificate:	Flight Instructor; Commercial	Age:	42, Male
Airplane Rating(s):	Single-engine Land	Seat Occupied:	Right
Other Aircraft Rating(s):	Helicopter	Restraint Used:	Seatbelt, Shoulder harness
Instrument Rating(s):	None	Second Pilot Present:	No
Instructor Rating(s):	Helicopter	Toxicology Performed:	No
Medical Certification:	Class 2 Valid Medical--no waivers/lim.	Last FAA Medical Exam:	08/28/1998
Occupational Pilot:		Last Flight Review or Equivalent:	
Flight Time:	3000 hours (Total, all aircraft), 300 hours (Total, this make and model), 2800 hours (Pilot In Command, all aircraft), 80 hours (Last 90 days, all aircraft), 25 hours (Last 30 days, all aircraft)		

Aircraft and Owner/Operator Information

Aircraft Make:	Bell	Registration:	N58126
Model/Series:	205A-1 205A-1	Aircraft Category:	Helicopter
Year of Manufacture:		Amateur Built:	No
Airworthiness Certificate:	Normal	Serial Number:	30136
Landing Gear Type:	High Skid	Seats:	15
Date/Type of Last Inspection:	11/09/1998, Annual	Certified Max Gross Wt.:	10200 lbs
Time Since Last Inspection:	33 Hours	Engines:	1 Turbo Shaft
Airframe Total Time:	6361 Hours	Engine Manufacturer:	Lycoming
ELT:	Installed, activated, did not aid in locating accident	Engine Model/Series:	T53-13B
Registered Owner:	CITY OF LOS ANGELES	Rated Power:	1400 hp
Operator:	CITY OF LOS ANGELES	Operating Certificate(s) Held:	None

Meteorological Information and Flight Plan

Conditions at Accident Site:	Visual Conditions	Condition of Light:	Night/Bright
Observation Facility, Elevation:	, 0 ft msl	Distance from Accident Site:	0 Nautical Miles
Observation Time:	0000	Direction from Accident Site:	0°
Lowest Cloud Condition:	Clear / 0 ft agl	Visibility	10 Miles
Lowest Ceiling:	None / 0 ft agl	Visibility (RVR):	0 ft
Wind Speed/Gusts:	8 knots /	Turbulence Type Forecast/Actual:	/
Wind Direction:	340°	Turbulence Severity Forecast/Actual:	/
Altimeter Setting:		Temperature/Dew Point:	16° C
Precipitation and Obscuration:			
Departure Point:	VAN NUYS, CA (VNY)	Type of Flight Plan Filed:	Company VFR
Destination:		Type of Clearance:	None
Departure Time:	2000 PST	Type of Airspace:	Class E

Wreckage and Impact Information

Crew Injuries:	1 Serious, 2 None	Aircraft Damage:	Substantial
Passenger Injuries:	N/A	Aircraft Fire:	None
Ground Injuries:	N/A	Aircraft Explosion:	None
Total Injuries:	1 Serious, 2 None	Latitude, Longitude:	

Administrative Information

Investigator In Charge (IIC):	JEFF RICH
Additional Participating Persons:	DALE HANSON; VAN NUYS, CA JACK SUTTLE; FORT WORTH, TX PHIL HENSLEY; PHOENIX, AZ ROD WILMOT; LOS ANGELES, CA
Investigation Docket:	NTSB accident and incident dockets serve as permanent archival information for the NTSB's investigations. Dockets released prior to June 1, 2009 are publicly available from the NTSB's Record Management Division at pubinq@ntsb.gov , or at 800-877-6799. Dockets released after this date are available at http://dms.nts.gov/pubdms/ .