



National Transportation Safety Board Aviation Accident Factual Report

Location:	BOCA RATON, FL	Accident Number:	MIA99LA117
Date & Time:	04/02/1999, 1557 EST	Registration:	N820MM
Aircraft:	Waco YMF-5	Aircraft Damage:	Substantial
Defining Event:		Injuries:	1 Serious, 1 Minor
Flight Conducted Under:	Part 91: General Aviation - Personal		

On April 2, 1999, about 1557 eastern standard time, a Waco YMF-5, N820MM, registered to MD Aero, Inc., operating as a 14 CFR Part 91 personal flight, crashed in a residential area in Boca Raton, Florida, following an engine failure. Visual meteorological conditions prevailed and no flight plan was filed. The airplane received substantial damage, the private-rated pilot sustained serious injuries, and a passenger sustained minor injuries. The flight originated from Fort Lauderdale's Executive Airport (FXE), about 17 minutes before the accident.

According to the pilot, the flight was maneuvering at 500 feet agl, about 1/2 mile off the coast northeast of Boca Raton when the engine and cowling began to shake, the engine began to sputter, and the windscreens became covered with oil. He stated that the engine power available was not enough to sustain level flight, so he set up a slow rate of descent and an immediate turn westbound. He declared an emergency with FAA Pompano Control Tower, told them he would try to make an emergency landing at Boca Raton Airport, and was given the unicom frequency for Boca Raton. He switched to the Boca frequency and raised a young woman's voice who said she would get help. He stated he could hear other aircraft in the traffic pattern stating they would yield to the emergency, but he made no further calls.

At about 1543, according to FAA Pompano Control Tower personnel, N820MM called that he just departed FXE eastbound and asked for clearance to transit their area along the beach in a south to north direction. At about 1552, he had reached the northern limit of Pompano's airspace and was cleared for a radio frequency change. At about 1554, Pompano tower heard a Mayday call from N820MM, and at about 1555, the pilot said he had an oil leak and would try to land at the Boca Raton Airport.

According to a pilot in the traffic pattern at Boca Raton Airport, when N820MM declared his emergency and stated his engine problem, he obtained a visual on the Waco and watched him proceed westbound from a point about 2 miles east of the airport. It became obvious to the pilot that the Waco pilot and passenger did not or could not see the Boca airport, because they flew "...right over the numbers for runway 23 at Boca, but kept on flying westbound".

According to the Boca Raton Police Services Department, the pilot advised them that the airplane "...developed engine problems and was trying to make Boca Raton Airport and was unable to see the runway and overshot the airport and crashed in the field." The airplane collided with trees in a residential area and came to rest inverted.

According to FAA inspectors, the airplane crashed about 2 miles west of the Boca Raton Airport, within a residential area. Postcrash examination of the Jacobs radial engine by FAA inspectors revealed the power loss was caused by the failure of the No. 7 cylinder holddown studs and the resultant lifting of the cylinder off its seat. Three of a total of 12 holddown studs, located on the aft side of the cylinder, revealed rust on their fractured surfaces. The remaining studs exhibited overload fractures. Piston wear marks on the walls of No. 7 cylinder reveal tilting of the cylinder away from the studs with rusted fracture sites. The power loss and oil leakage were the result of induction piping and oil line connections being stripped when the cylinder started lifting off its seat. Inspectors reported that the only thing holding No. 7 cylinder on the engine was baffling jammed against the cowl. About 140 engine operating hours before the accident, on March 3, 1998, the engine was reinstalled by General Aviation, Inc. of Lansing, Michigan, after a Jacobs Engine, Inc. factory teardown inspection due to a landing nose over incident.

Pilot Information

Certificate:	Private	Age:	64, Male
Airplane Rating(s):	Single-engine Land	Seat Occupied:	Rear
Other Aircraft Rating(s):	None	Restraint Used:	Seatbelt, Shoulder harness
Instrument Rating(s):	Airplane	Second Pilot Present:	No
Instructor Rating(s):	None	Toxicology Performed:	No
Medical Certification:	Class 3 Valid Medical--w/ waivers/lim.	Last FAA Medical Exam:	12/03/1997
Occupational Pilot:	Last Flight Review or Equivalent:		
Flight Time:	2228 hours (Total, all aircraft), 547 hours (Total, this make and model), 2088 hours (Pilot In Command, all aircraft), 36 hours (Last 90 days, all aircraft), 15 hours (Last 30 days, all aircraft), 3 hours (Last 24 hours, all aircraft)		

Aircraft and Owner/Operator Information

Aircraft Make:	Waco	Registration:	N820MM
Model/Series:	YMF-5 YMF-5	Aircraft Category:	Airplane
Year of Manufacture:		Amateur Built:	No
Airworthiness Certificate:	Normal	Serial Number:	F5C056
Landing Gear Type:	Tailwheel	Seats:	2
Date/Type of Last Inspection:	04/03/1998, Annual	Certified Max Gross Wt.:	2950 lbs
Time Since Last Inspection:	156 Hours	Engines:	1 Reciprocating
Airframe Total Time:	731 Hours	Engine Manufacturer:	Jacobs
ELT:	Installed	Engine Model/Series:	R755B2M
Registered Owner:	MD AERO, INC.	Rated Power:	275 hp
Operator:	MD AERO, INC.	Operating Certificate(s) Held:	None

Meteorological Information and Flight Plan

Conditions at Accident Site:	Visual Conditions	Condition of Light:	Day
Observation Facility, Elevation:	PBI, 17 ft msl	Distance from Accident Site:	21 Nautical Miles
Observation Time:	1553 EST	Direction from Accident Site:	10°
Lowest Cloud Condition:	Unknown / 0 ft agl	Visibility	10 Miles
Lowest Ceiling:	Broken / 6000 ft agl	Visibility (RVR):	0 ft
Wind Speed/Gusts:	10 knots /	Turbulence Type Forecast/Actual:	/
Wind Direction:	130°	Turbulence Severity Forecast/Actual:	/
Altimeter Setting:	30 inches Hg	Temperature/Dew Point:	28° C / 22° C
Precipitation and Obscuration:			
Departure Point:	FT. LAUDERDALE, FL (FXE)	Type of Flight Plan Filed:	None
Destination:		Type of Clearance:	None
Departure Time:	1540 EST	Type of Airspace:	Class E

Wreckage and Impact Information

Crew Injuries:	1 Serious	Aircraft Damage:	Substantial
Passenger Injuries:	1 Minor	Aircraft Fire:	None
Ground Injuries:	N/A	Aircraft Explosion:	None
Total Injuries:	1 Serious, 1 Minor	Latitude, Longitude:	

Administrative Information

Investigator In Charge (IIC):	ALAN C STONE
Additional Participating Persons:	DAVID HAMMOND; FT. LAUDERDALE, FL
Investigation Docket:	NTSB accident and incident dockets serve as permanent archival information for the NTSB's investigations. Dockets released prior to June 1, 2009 are publicly available from the NTSB's Record Management Division at pubin@ntsb.gov , or at 800-877-6799. Dockets released after this date are available at http://dms.nts.gov/pubdms/ .