



National Transportation Safety Board Aviation Accident Final Report

Location:	TELLURIDE, CO	Accident Number:	FTW94FA114
Date & Time:	04/01/1994, 1145 MST	Registration:	N59715
Aircraft:	AEROSPATIALE AS-350-B2	Aircraft Damage:	Substantial
Defining Event:		Injuries:	1 Serious, 4 Minor, 1 None

Flight Conducted Under: Part 135: Air Taxi & Commuter - Non-scheduled

Analysis

WHILE CONDUCTING A VISUAL APPROACH TO A LANDING ZONE AT 12,800 FEET MSL IN MOUNTAINOUS TERRAIN, THE PILOT MADE A RIGHT TURN FROM DOWN WIND TO BASE TO FINAL WHICH PLACED THE HELICOPTER IN A DOWN SLOPE WIND CONDITION. THE HELICOPTER SETTLED, TURNED TO THE LEFT AROUND THE VERTICAL AXIS, AND IMPACTED THE SIDE OF THE MOUNTAIN BELOW THE LANDING ZONE. THE TAIL BOOM SEPARATED AND THE FUSELAGE ROLLED DOWN THE MOUNTAIN SIDE DURING WHICH TIME THE PASSENGERS WERE EJECTED. THE INVESTIGATION PROVIDED NO EVIDENCE OF PREIMPACT FAILURE OR MALFUNCTION. MAXIMUM GROSS WEIGHT WAS 4960 POUNDS. ACTUAL GROSS WEIGHT WAS 4375 POUNDS.

Probable Cause and Findings

The National Transportation Safety Board determines the probable cause(s) of this accident to be: FAILURE BY THE PILOT TO MAINTAIN CONTROL OF THE AIRCRAFT. FACTORS WERE UNFAVORABLE WINDS AND IMPROPER APPROACH PLANNING.

Findings

Occurrence #1: LOSS OF CONTROL - IN FLIGHT

Phase of Operation: APPROACH - VFR PATTERN - BASE LEG/BASE TO FINAL

Findings

1. TERRAIN CONDITION - HIGH TERRAIN
2. TERRAIN CONDITION - MOUNTAINOUS/HILLY
3. (F) WEATHER CONDITION - UNFAVORABLE WIND
4. (F) PLANNED APPROACH - IMPROPER - PILOT IN COMMAND
5. (C) AIRCRAFT CONTROL - NOT MAINTAINED - PILOT IN COMMAND

Occurrence #2: IN FLIGHT COLLISION WITH TERRAIN/WATER

Phase of Operation: DESCENT - UNCONTROLLED

Factual Information

HISTORY OF FLIGHT

On April 1, 1994, at 1145 mountain standard time, an Aerospatiale AS350 B2 helicopter, N59715, impacted terrain approximately 7 miles southwest of Telluride, Colorado. Of the six persons on board, one received serious injuries, four minor injuries and one no injuries. The helicopter sustained substantial damage. Visual meteorological conditions prevailed for this commercial, on demand, CFR part 135 air taxi flight and no flight plan was filed.

According to the pilot, the flight originated from a landing zone known as Bridal Vail Falls at 1130. The purpose of the flight was to deliver the passengers to Waterfall Canyon landing zone at 12,800 feet above mean sea level for skiing. The pilot stated that he overflew the landing zone headed in a westerly direction and made a right hand turn to final approach. The landing zone, which was being used, was located in a saddle with rising terrain to the north and south. A passenger was taking a video at the time of the approach and it indicates that a right hand turn was made which placed the helicopter to the southwest and below the rising terrain to the north of the landing zone. The person taking the video dropped the camera so the accident sequence was not taped. (See attached pilot supplied diagrams.)

Interviews provided information that as the helicopter was turning final, it began to settle and turn to the left around the vertical axis. According to the pilot, the helicopter rotated one or possibly two times with right pedal having no effect. Witnesses provided information that the turns were not rapid. The helicopter impacted the slope below the landing zone and rolled down the 40 degree slope. Snow depth on the slope was approximately 4 feet.

Available information indicates that the occupants were thrown from the helicopter during the roll down the slope; however, no evidence was found of restraint system failure or malfunction. A seating diagram is attached.

PERSONAL INFORMATION

According to information provided on the enclosed National Transportation Safety Board Form 6120.1/2, the pilot had approximately 3,900 hours flight time in helicopters. About 500 hours was in this make and model. No evidence was found during the investigation which documented the amount of mountain flying experience of the pilot or if he had any formal mountain flying training.

AIRCRAFT INFORMATION

According to the manufacturer's information, maximum certified gross weight for this aircraft was 4,960 pounds. Estimated weight at the time of the accident was 4,375 pounds based on the weights provided in the attached seating diagram.

METEOROLOGICAL INFORMATION

According to the pilot, there were scattered clouds at 5,000 feet above ground level and the wind was from the northeast at 10 to 15 mph in the vicinity of the accident site. Wind from the direction indicated would place the helicopter in a down slope wind while the turn to final approach was being executed.

WRECKAGE AND IMPACT INFORMATION

The tail boom separated from the aircraft and was located below and to the north of the

landing zone approximately 150 feet. Rotational marks were found in the tail rotor drive tunnel at the separation point. The tail boom separation point at the fuselage junction was buckled inward on the left and bottom and rotational twisting was present at the separation point of the tail rotor drive shaft at the transmission deck exit. The tail boom and tail rotor system incurred minor damage.

The remainder of the helicopter was scattered down the slope from the tail boom for a distance of approximately 300 feet. The transmission remained attached and the main rotor blades fractured near the hub. The left portion of the nose and fuselage top were crushed inward.

The engine separated from the airframe during the impact sequence. It was later placed on a test cell and functioned normally. (See attached engine report).

The two front seats separated from the aircraft with the separation point being in the composite support structure above the seat attach point. The rear bench seat exhibited minor downward crushing of the support structure.

Examination of the helicopter during the course of the investigation provided no evidence of preimpact structural failure or system failure or malfunction.

ADDITIONAL DATA/INFORMATION

The wreckage was released to Mr. D. K. Jason, Jason and Associates, on June 13, 1994. No parts were retained.

Pilot Information

Certificate:	Airline Transport; Flight Instructor; Commercial	Age:	35, Male
Airplane Rating(s):	Multi-engine Land; Single-engine Land	Seat Occupied:	Right
Other Aircraft Rating(s):	Glider; Helicopter	Restraint Used:	
Instrument Rating(s):	Airplane	Second Pilot Present:	No
Instructor Rating(s):	Helicopter	Toxicology Performed:	No
Medical Certification:	Class 2 Valid Medical--no waivers/lim.	Last FAA Medical Exam:	08/19/1993
Occupational Pilot:		Last Flight Review or Equivalent:	
Flight Time:	7100 hours (Total, all aircraft), 500 hours (Total, this make and model), 7025 hours (Pilot In Command, all aircraft), 110 hours (Last 90 days, all aircraft), 25 hours (Last 30 days, all aircraft), 3 hours (Last 24 hours, all aircraft)		

Aircraft and Owner/Operator Information

Aircraft Make:	AEROSPATIALE	Registration:	N59715
Model/Series:	AS-350-B2 AS-350-B2	Aircraft Category:	Helicopter
Year of Manufacture:		Amateur Built:	No
Airworthiness Certificate:	Normal	Serial Number:	2581
Landing Gear Type:	Skid	Seats:	6
Date/Type of Last Inspection:	02/09/1994, 100 Hour	Certified Max Gross Wt.:	4960 lbs
Time Since Last Inspection:	55 Hours	Engines:	1 Turbo Shaft
Airframe Total Time:	560 Hours	Engine Manufacturer:	TURBOMECA
ELT:	Installed, activated, did not aid in locating accident	Engine Model/Series:	ARRIEL 1D1
Registered Owner:	ALPINE PACIFIC, INC.	Rated Power:	732 hp
Operator:	ALPINE PACIFIC, INC.	Operating Certificate(s) Held:	On-demand Air Taxi (135)
Operator Does Business As:	ALPINE PACIFIC AIR	Operator Designator Code:	OMGA

Meteorological Information and Flight Plan

Conditions at Accident Site:	Visual Conditions	Condition of Light:	Day
Observation Facility, Elevation:	TEX, 9086 ft msl	Distance from Accident Site:	13 Nautical Miles
Observation Time:	1153 MST	Direction from Accident Site:	60°
Lowest Cloud Condition:	Scattered / 6000 ft agl	Visibility	25 Miles
Lowest Ceiling:	None / 0 ft agl	Visibility (RVR):	0 ft
Wind Speed/Gusts:	16 knots / 28 knots	Turbulence Type Forecast/Actual:	/
Wind Direction:	270°	Turbulence Severity Forecast/Actual:	/
Altimeter Setting:	30 inches Hg	Temperature/Dew Point:	8° C
Precipitation and Obscuration:			
Departure Point:		Type of Flight Plan Filed:	None
Destination:	(TEX)	Type of Clearance:	None
Departure Time:	1130 MST	Type of Airspace:	Class G

Wreckage and Impact Information

Crew Injuries:	1 None	Aircraft Damage:	Substantial
Passenger Injuries:	1 Serious, 4 Minor	Aircraft Fire:	None
Ground Injuries:	N/A	Aircraft Explosion:	None
Total Injuries:	1 Serious, 4 Minor, 1 None	Latitude, Longitude:	

Administrative Information

Investigator In Charge (IIC): NORMAN F WIEMEYER, **Report Date:** 12/07/1994

Additional Participating Persons: MAX MCCARTHUR; SALT LAKE CITY, UT

Publish Date:

Investigation Docket: NTSB accident and incident dockets serve as permanent archival information for the NTSB's investigations. Dockets released prior to June 1, 2009 are publicly available from the NTSB's Record Management Division at pubinq@ntsb.gov, or at 800-877-6799. Dockets released after this date are available at <http://dms.nts.gov/pubdms/>.

The National Transportation Safety Board (NTSB), established in 1967, is an independent federal agency mandated by Congress through the Independent Safety Board Act of 1974 to investigate transportation accidents, determine the probable causes of the accidents, issue safety recommendations, study transportation safety issues, and evaluate the safety effectiveness of government agencies involved in transportation. The NTSB makes public its actions and decisions through accident reports, safety studies, special investigation reports, safety recommendations, and statistical reviews.

The Independent Safety Board Act, as codified at 49 U.S.C. Section 1154(b), precludes the admission into evidence or use of any part of an NTSB report related to an incident or accident in a civil action for damages resulting from a matter mentioned in the report. A factual report that may be admissible under 49 U.S.C. § 1154(b) is available [here](#).