



National Transportation Safety Board Aviation Accident Factual Report

Location:	Ainsworth, NE	Accident Number:	CHI05LA050
Date & Time:	01/01/2005, 1120 CST	Registration:	N35403
Aircraft:	Cessna 551	Aircraft Damage:	Substantial
Defining Event:		Injuries:	2 Minor, 3 None
Flight Conducted Under:	Part 91: General Aviation - Personal		

On January 1, 2005, around 1120 central standard time, a Cessna 551 (Citation II), N35403, piloted by an instrument rated private pilot, was substantially damaged during an in-flight collision with terrain while attempting to land at Ainsworth Municipal Airport (ANW), Ainsworth, Nebraska. Instrument meteorological conditions (IMC) prevailed at the time of the accident. The personal flight was being operated under the provisions of 14 Code of Federal Regulations (CFR) Part 91 while on an instrument flight rules (IFR) flight plan. The pilot and three passengers were not injured. Two passengers reported minor injuries. The cross-country flight departed Reading Regional Airport (RDG), Reading, Pennsylvania, at 0808 eastern standard time.

At 1113:16 (hhmm:ss), the accident airplane was cleared for the Global Positioning System (GPS) Runway 17 instrument approach into ANW. The pilot stated that the airplane started to accumulate ice around 4,000 feet mean sea level (msl) during the approach. The pilot reported that he had "all of the anti-ice and deicing equipment working" during the approach. The pilot stated that "at some point the icing conditions became more than the equipment could handle" and the windscreen became obscured by ice. The pilot reported that he descended out of IMC "between 300 and 400 feet" above ground level (agl). The pilot stated that he "had difficulty seeing the runway" due to the accumulation of ice on the windscreen and he elected to land the airplane instead of executing the published missed-approach procedure.

A witness to the accident reported seeing the "aft end of a jet heading to the north in a slight bank to the right, I didn't notice the wheels down so I assumed that the jet was making a go-around for another attempt at the approach." The witness stated he didn't see the airplane impact the terrain but did "hear three loud audible pops and saw [what] appeared to be smoke rising over the hangar."

On January 2, 2005, a Federal Aviation Administration (FAA) inspector and an airframe representative performed an on-scene investigation. The first point of impact was about 439 feet north of the approach end of runway 17 (6,824 feet by 110 feet, asphalt). The aircraft traveled south about 18 feet prior to contacting an airport access road. The aircraft then became airborne and touched down for the second time after traveling south about 54 feet.

The aircraft then slid in a right arc about 700 feet and came to rest parallel to a taxiway that services runway 17.

Temperatures at the accident site had remained well below freezing from the time of impact until the on-scene investigation. Pieces of rime ice were found along the wreckage path. These ice pieces were 1/4 to 3/8-inch thick and were shaped similar to the leading edge of a wing.

First responders had sprayed the airplane with fire suppression foam after the accident as a precaution. There was no evidence of an in-flight or post-impact fire. The foam had degraded the condition of the ice in some areas along both wings. However, photographs taken by first responders show ice accumulation on all booted surfaces measuring 2-4 inches wide and 1/4 to 3/8 inch thick. The upper portions of the windscreens were contaminated with ice measuring about 3/8 inch thick. The remaining airframe portions, including the heated surfaces, were free of ice accumulation.

The windshield bleed air switch was selected on "High" with the pilot's side windshield heat control knob approximately mid-range. Windshield alcohol was selected "On", but the alcohol reservoir was still full upon inspection.

The closest weather reporting station to the accident site was located at ANW. The airport is equipped with an Automated Surface Observing System (ASOS). The following weather conditions were reported prior to and after the time of the accident:

At 1110: Wind 020 degrees true at 3 knots, visibility 2-1/2 statute miles (sm) with mist, overcast ceiling at 500 feet agl, temperature -08 degrees Celsius, dew point -09 degrees Celsius, altimeter setting 30.03 inches of mercury.

At 1130: Wind 030 degrees true at 3 knots, visibility 1-3/4 sm with mist, overcast ceiling at 500 feet agl, temperature -08 degrees Celsius, dew point -09 degrees Celsius, altimeter setting 30.02 inches of mercury.

The published minimum descent altitude (MDA) for the GPS runway 17 approach is 500 feet agl, for an airplane equipped with a lateral navigation only GPS receiver.

The pilot held a private pilot certificate with multi-engine land, instrument airplane, and Cessna 500 type ratings. The pilot reported having 2,200 hours total flight time and 475 hours in the same make/model as the accident airplane.

Pilot Information

Certificate:	Private	Age:	57, Male
Airplane Rating(s):	Multi-engine Land	Seat Occupied:	Left
Other Aircraft Rating(s):	None	Restraint Used:	Seatbelt, Shoulder harness
Instrument Rating(s):	Airplane	Second Pilot Present:	No
Instructor Rating(s):	None	Toxicology Performed:	No
Medical Certification:	Class 3 With Waivers/Limitations	Last FAA Medical Exam:	05/01/2004
Occupational Pilot:		Last Flight Review or Equivalent:	05/01/2003
Flight Time:	2200 hours (Total, all aircraft), 475 hours (Total, this make and model), 2200 hours (Pilot In Command, all aircraft), 60 hours (Last 90 days, all aircraft), 20 hours (Last 30 days, all aircraft), 0 hours (Last 24 hours, all aircraft)		

Aircraft and Owner/Operator Information

Aircraft Make:	Cessna	Registration:	N35403
Model/Series:	551	Aircraft Category:	Airplane
Year of Manufacture:		Amateur Built:	No
Airworthiness Certificate:	Normal	Serial Number:	551-0029
Landing Gear Type:	Retractable - Tricycle	Seats:	10
Date/Type of Last Inspection:	10/01/2003, Continuous Airworthiness	Certified Max Gross Wt.:	12500 lbs
Time Since Last Inspection:	188 Hours	Engines:	2 Turbo Fan
Airframe Total Time:	5870 Hours at time of accident	Engine Manufacturer:	Pratt & Whitney
ELT:	Installed, activated, did not aid in locating accident	Engine Model/Series:	JT15D-4
Registered Owner:	Jet Services, LLC.	Rated Power:	2500 lbs
Operator:	Jet Services, LLC.	Operating Certificate(s) Held:	None

Meteorological Information and Flight Plan

Conditions at Accident Site:	Instrument Conditions	Condition of Light:	Day
Observation Facility, Elevation:	ANW, 2589 ft msl	Distance from Accident Site:	0 Nautical Miles
Observation Time:	1130 CST	Direction from Accident Site:	0°
Lowest Cloud Condition:		Visibility	1.75 Miles
Lowest Ceiling:	Overcast / 500 ft agl	Visibility (RVR):	
Wind Speed/Gusts:	3 knots /	Turbulence Type Forecast/Actual:	/
Wind Direction:	30°	Turbulence Severity Forecast/Actual:	/
Altimeter Setting:	30.02 inches Hg	Temperature/Dew Point:	-8° C / -9° C
Precipitation and Obscuration:	Freezing - Mist		
Departure Point:	Reading, PA (RDG)	Type of Flight Plan Filed:	IFR
Destination:	Ainsworth, NE (ANW)	Type of Clearance:	IFR
Departure Time:	0808 EST	Type of Airspace:	

Airport Information

Airport:	Ainsworth Municipal Airport (ANW)	Runway Surface Type:	Asphalt
Airport Elevation:	2589 ft	Runway Surface Condition:	Ice
Runway Used:	17	IFR Approach:	Global Positioning System
Runway Length/Width:	6824 ft / 110 ft	VFR Approach/Landing:	None

Wreckage and Impact Information

Crew Injuries:	1 None	Aircraft Damage:	Substantial
Passenger Injuries:	2 Minor, 2 None	Aircraft Fire:	None
Ground Injuries:	N/A	Aircraft Explosion:	None
Total Injuries:	2 Minor, 3 None	Latitude, Longitude:	42.579167, -99.993056

Administrative Information

Investigator In Charge (IIC):	Andrew T Fox
Additional Participating Persons:	Robert F Johnson; Federal Aviation Administration - Lincoln FSDO; Lincoln, NE Steve Miller; Cessna Aircraft Company; Wichita, KS
Investigation Docket:	NTSB accident and incident dockets serve as permanent archival information for the NTSB's investigations. Dockets released prior to June 1, 2009 are publicly available from the NTSB's Record Management Division at pubinq@ntsb.gov , or at 800-877-6799. Dockets released after this date are available at http://dms.nts.gov/pubdms/ .