



National Transportation Safety Board Aviation Accident Factual Report

Location:	Waterford, MI	Accident Number:	CEN13FA364
Date & Time:	06/21/2013, 1340 EDT	Registration:	N9926Q
Aircraft:	CESSNA 172M	Aircraft Damage:	Destroyed
Defining Event:	Loss of control in flight	Injuries:	4 Fatal
Flight Conducted Under:	Part 91: General Aviation - Personal		

HISTORY OF FLIGHT

On June 21, 2013, about 1340 eastern daylight time, a Cessna 172M, N9926Q, impacted terrain during takeoff at the Oakland County International Airport (KPTK), Waterford, Michigan. The pilot and three passengers were fatally injured. The airplane was destroyed. The airplane was registered to and being operated by Flight 101, LLC, Waterford, Michigan, under the provisions of 14 Code of Federal Regulations Part 91 as a personal flight. Visual meteorological conditions (VMC) prevailed, and no flight plan had been filed. The local flight was originating at the time of the accident.

According to Federal Aviation Administration (FAA) records, the pilot of N9926Q contacted KPTK ground control at 1328 and requested taxi instructions for a visual flight rules (VFR) flight to the west. He indicated he had received the current Automatic Terminal Information Service (ATIS) information. At 1338, KPTK local control cleared N9926Q for takeoff on runway 09L from intersection M (Mike). Control tower personnel saw the airplane lift off the runway and attain an altitude of about 100 feet. Shortly thereafter, at 1340, the pilot advised that he was "a little overweight" and would need to return and land. He was cleared to land on runway 09R or on the grass area surrounding the runways. There was no reply. The airplane was seen to impact the ground. A post-crash fire ensued.

There were several witnesses to the accident. One witness was working in a nearby hangar and heard an airplane having "engine trouble." He saw the airplane about 100 feet in the air and the engine was "spitting and sputtering." The airplane was crabbing about 30 degrees while flying straight in line with the runway. The engine became "quiet," then regained power and

began "spitting and sputtering" again. The airplane then descended in a nose-down attitude, impacted the ground and spun around.

Another witness, a pilot, was approaching runway 09L for landing. As he turned onto the base leg for runway 09L, N9926Q lifted off the runway. The pilot-witness noticed the airplane was not climbing as it should and it appeared the flaps were extended. As he turned onto final approach for landing, he saw the airplane "lagging" and "wallowing in the air with flaps extended." As he flared for landing, he heard the pilot of N9926Q tell the control tower that he was a little overweight and needed to return. The witness then saw the airplane about 100 to 200 feet in the air over the threshold of runway 27R, and its wings were "shaky." The left wing dipped and the airplane descended, struck the ground with its left wing, and pivoted 180 degrees. When the airplane struck the ground, a big divot of dirt was thrown into the air. A fire ball erupted about 3 to 5 seconds after impact.

PERSONNEL INFORMATION

The pilot, age 19, enrolled in Western Michigan University's (WMU) FAA-approved 49 Code of Federal Regulations Part 141 flight school on August 28, 2012, flying the Cirrus SR20 exclusively. He received his private pilot certificate with an airplane single-engine land rating on May 2, 2013. He held a first class airman medical certificate, dated October 9, 2012, with the limitation that he must wear corrective lenses while exercising the privileges of his pilot certificate. He had recently been accepted as a midshipman at the United States Naval Academy. The accident occurred a little more than a month after he received his pilot's certificate.

The pilot's logbook was never located. According to the FAA and WMU training records, when the pilot took his private pilot practical test on May 2, 2013, he had logged 52.3 hours total time, of which 42.2 hours were dual instruction. The pilot had reportedly flown a Cessna 172 for a few hours when he was in Florida, but this report could not be substantiated.

AIRCRAFT INFORMATION

N9926Q, serial number 17265870, was manufactured by the Cessna Aircraft Corporation in 1976. It was powered by a Lycoming O-320-E2D engine, serial number L-40946-27A, rated at 150 horsepower, driving a McCauley 2-blade, all-metal, fixed pitch propeller (model DTM7553, serial number 728396).

According to the aircraft maintenance records, the last annual and 100-hour inspections were done on May 23, 2013, at a tachometer time of 3,467.3 hours. At that time, the airframe and engine had accrued 17,949.3 hours and 13,016.8 hours, respectively, and 2,352.8 hours had elapsed since the last engine major overhaul. At the accident site, the tachometer read 3,539.5 hours.

METEOROLOGICAL INFORMATION

The following weather observations were recorded by KPTK's Automated Surface Observing Station (ASOS) at 1321:

Wind, 130 degrees at 6 knots; visibility, 10 statute miles; sky condition, 9,000 feet scattered, ceiling, 15,000 feet broken, 25,000 feet overcast; temperature, 28 degrees Celsius (C.); dew point, 17 degrees C.; altimeter, 30.17 inches of mercury.

AERODROME INFORMATION

Oakland County International Airport (KPTK) is located in Waterford, Michigan, about 5 miles west of Pontiac, Michigan. It is situated at an elevation of 981 feet msl (mean sea level), and is served by 3 runways: 09R-27L, 09L-27R, and 18-36. At the time of the accident, N9926Q was taking off on runway 09L-27R (5,676 feet x 100 feet, asphalt, porous friction course overlay).

WRECKAGE AND IMPACT INFORMATION

N9926Q started its takeoff roll on runway 09L from intersection M (5,320 feet of runway available). The airplane impacted terrain slightly to the left and just past the departure end of the runway at a location of 42 degrees, 40.035' north latitude and 83 degrees, 24.742' west longitude.

The on-scene investigation revealed the airplane impacted terrain in a nose-low, left wing-low attitude. There was a ground scar, measuring 7 feet long and 4 feet wide and aligned on a magnetic heading of 060 degrees, extending from the initial impact point to the wreckage. Upon impact, the airplane rotated approximately 180 degrees, coming to rest on a magnetic heading of 300 degrees. The cockpit area was consumed by post-impact fire. The airplane was equipped with seat belts and shoulder harnesses, but the webbing had been burned away.

The propeller blades bore chordwise and spanwise scratches on the camber surfaces. One blade had separated at mid-point. The separated piece was found in the impact crater, and was bent 90 degrees forward. The other blade bore a slight S-bend along its length.

The flap handle was burned away. The flap gage registered 0 degrees, but it had been burned and the needle was free to move. The wings flaps were full down. The flap actuator measured approximately 5.8 inches, which equated to flaps fully extended (40 degrees). The elevator trim tab measured between 0 and 5 degrees tab up.

After cleaning off the soot from the instrument glass, the airspeed indicator registered 0 KIAS (knots indicated airspeed), and the heading indicator was aligned with 245 degrees. The vertical speed indicator was unreadable. The altimeter read 2,660 feet, and the Kollsman window was set to 30.15 inches of mercury. The tachometer read 0 rpm and the recorder read 3,539.5 hours. The master switch was on, and the magnetos were on BOTH although the key was broken off. The fuel selector handle was separated from the fuel selector valve. The valve was not located. The emergency locator transmitter (ELT) activated on impact and was turned off by first responders. Control continuity was established.

There was no evidence of pre-impact airframe, power plant, or propeller malfunction or failure.

MEDICAL AND PATHOLOGICAL INFORMATION

According to the autopsy report, the pilot's death was attributed to thermal injuries. Specks of soot were found in the trachea. The only significant injury found was a closed fracture of the left ankle.

The Oakland County toxicology report found less than 1% carboxyhemoglobin saturation. Toxicological screening performed by FAA's Civil Aerospace Medical Institute (CAMI) revealed no carbon monoxide in blood and no ethanol in vitreous. Cyanide tests were not performed. Urine analysis detected 33.8 (ug/ml, ug/g) salicylate (aspirin).

TESTS AND RESEARCH

Security Camera Footage

Two videos from airport security cameras were sent to NTSB's Vehicle Recorder Division. The airplane can be seen taking off from runway 09L, climbing to about 150 feet, and then descending to the ground in a left wing-low attitude. A plume of smoke appears shortly thereafter.

Weight and Balance

Weight and balance calculations were performed by Cessna's technical representative, to wit:

Empty weight (dated July 15, 2005)	1,471.5 pounds
Occupants (from medical certificate and Michigan drivers licenses)	683
Estimated fuel on board *	___144_____
Estimated gross weight	2,298.5 pounds
Maximum allowable gross weight	2,300 pounds

*The airplane had previously been fueled to capacity. Another renter-pilot flew the airplane for about two hours prior to the accident.

Flaps

The majority of the pilot's flight experience was in the Cirrus SR20. Both the Cirrus SR20 and Cessna 172M wing flaps are electrically operated. The Cirrus wing flap switch is directly in front of the throttle control and has three position detents: UP (0 per cent), 50 per cent, and 100 per cent. Setting the switch to the desired position causes the flaps to extend or retract to the appropriate setting. An indicator light at each control switch position illuminates when the flaps reach the selected position. The UP (0 per cent) light is green and the 50 per cent and 100 per cent lights are yellow. The Cessna 172M employs a spring-loaded switch that must be held down or up until the desired flap setting is attained as indicated by the flap gage with markings at 0 degrees, 10 degrees, 20 degrees, 30 degrees, and 40 degrees.

The Western Michigan University Cirrus SR20 preflight checklist requires the pilot to begin his preflight inspection with the flaps set at 0. The pilot then places the flaps at 50 per cent and 100 per cent, checking for proper annunciator light illumination. The Cessna 172M preflight checklist in the Pilot's Operating Handbook does not require the extension of the flaps for preflight inspection. Cirrus SR20 takeoffs are normally made using 50 per cent flaps. Takeoffs in the Cessna 172M are normally made with the flaps up.

Pilot Information

Certificate:	Private	Age:	19
Airplane Rating(s):	Single-engine Land	Seat Occupied:	Left
Other Aircraft Rating(s):	None	Restraint Used:	Seatbelt
Instrument Rating(s):	None	Second Pilot Present:	No
Instructor Rating(s):	None	Toxicology Performed:	Yes
Medical Certification:	Class 1 With Waivers/Limitations	Last FAA Medical Exam:	10/09/2012
Occupational Pilot:	No	Last Flight Review or Equivalent:	05/02/2013
Flight Time:	52 hours (Total, all aircraft), 2 hours (Total, this make and model), 8 hours (Pilot In Command, all aircraft)		

Aircraft and Owner/Operator Information

Aircraft Make:	CESSNA	Registration:	N9926Q
Model/Series:	172M	Aircraft Category:	Airplane
Year of Manufacture:		Amateur Built:	No
Airworthiness Certificate:	Normal; Utility	Serial Number:	17265870
Landing Gear Type:	Tricycle	Seats:	4
Date/Type of Last Inspection:	05/23/2013, 100 Hour	Certified Max Gross Wt.:	2300 lbs
Time Since Last Inspection:	72 Hours	Engines:	1 Reciprocating
Airframe Total Time:	17949 Hours as of last inspection	Engine Manufacturer:	Lycoming
ELT:	Installed, activated, did not aid in locating accident	Engine Model/Series:	O-320-E2D
Registered Owner:	Flight 101, LLC	Rated Power:	150 hp
Operator:	Flight 101, LLC	Operating Certificate(s) Held:	None

Meteorological Information and Flight Plan

Conditions at Accident Site:	Visual Conditions	Condition of Light:	Day
Observation Facility, Elevation:	KPTK, 981 ft msl	Distance from Accident Site:	
Observation Time:	1240 EDT	Direction from Accident Site:	
Lowest Cloud Condition:	Scattered / 9000 ft agl	Visibility	10 Miles
Lowest Ceiling:	Broken / 15000 ft agl	Visibility (RVR):	
Wind Speed/Gusts:	6 knots /	Turbulence Type Forecast/Actual:	/
Wind Direction:	130°	Turbulence Severity Forecast/Actual:	/
Altimeter Setting:	30.17 inches Hg	Temperature/Dew Point:	28° C / 17° C
Precipitation and Obscuration:			
Departure Point:	Waterford, MI (KPTK)	Type of Flight Plan Filed:	None
Destination:	Waterford, MI (KPTK)	Type of Clearance:	VFR
Departure Time:	1340 EDT	Type of Airspace:	

Airport Information

Airport:	Oakland County International (KPTK)	Runway Surface Type:	Asphalt
Airport Elevation:	981 ft	Runway Surface Condition:	Dry
Runway Used:	09L	IFR Approach:	None
Runway Length/Width:	5676 ft / 100 ft	VFR Approach/Landing:	None

Wreckage and Impact Information

Crew Injuries:	1 Fatal	Aircraft Damage:	Destroyed
Passenger Injuries:	3 Fatal	Aircraft Fire:	On-Ground
Ground Injuries:	N/A	Aircraft Explosion:	None
Total Injuries:	4 Fatal	Latitude, Longitude:	42.667222, -83.412222

Administrative Information

Investigator In Charge (IIC):	Arnold W Scott
Additional Participating Persons:	Douglas A Peterson; FAA Flight Standards District Office; Belleview, MI Henry J Soderlund; Cessna Aircraft Corporation; Wichita, KS
Investigation Docket:	http://dms.nts.gov/pubdms/search/dockList.cfm?mKey=87264