



National Transportation Safety Board Aviation Accident Final Report

Location:	Geneseo, IL	Accident Number:	CEN14CA365
Date & Time:	07/02/2014, CDT	Registration:	N2209G
Aircraft:	CESSNA 182A	Aircraft Damage:	Substantial
Defining Event:	Fuel exhaustion	Injuries:	1 Minor
Flight Conducted Under:	Part 91: General Aviation - Skydiving		

Analysis

The pilot was on final approach when the engine started to run out of fuel. She said her boss had a similar problem on a previous flight, and had to correct for it by pitching the nose up and down to force fuel into the fuel lines. The pilot recalled pitching the nose up and down but nothing after that. A witness, who saw the airplane pitching up and down several times before it impacted the ground, responded to the crash. He noted that the fuel selector was set to the "both" position and no fuel was leaking from either fuel tank's gas cap. When the airplane was righted, the witness said he saw several gallons of fuel drain from the left tank but not the right tank. When he visually checked the right fuel tank, it was empty. The left tank had about 9 gallons (about 6.5 gallons usable) still in the tank. A postaccident examination of the airplane by a Federal Aviation Administration inspector revealed the airplane sustained substantial damage to the firewall, forward engine mounts, right wing and vertical stabilizer and rudder. About 6 gallons of fuel was drained from the left wing tank and the right tank was empty. A review of the terrain where the airplane impacted the ground revealed the vegetation around the left tank was discolored from fuel, but the area around the right tank was not. No pre mishap mechanical discrepancies were noted with the engine or airplane that would have precluded normal operation.

Probable Cause and Findings

The National Transportation Safety Board determines the probable cause(s) of this accident to be: The pilot's mismanagement of the available fuel supply, which resulted in a loss of engine power due to fuel exhaustion.

Findings

Aircraft	Fuel - Fluid management (Cause)
Personnel issues	Decision making/judgment - Pilot (Cause)

Factual Information

History of Flight

Approach-VFR pattern final Fuel exhaustion (Defining event)

Pilot Information

Certificate:	Commercial	Age:	21
Airplane Rating(s):	Multi-engine Land; Single-engine Land	Seat Occupied:	Left
Other Aircraft Rating(s):	None	Restraint Used:	
Instrument Rating(s):	Airplane	Second Pilot Present:	
Instructor Rating(s):	None	Toxicology Performed:	
Medical Certification:	Class 1 Without Waivers/Limitations	Last Medical Exam:	06/04/2014
Occupational Pilot:		Last Flight Review or Equivalent:	
Flight Time:	233 hours (Total, all aircraft)		

Aircraft and Owner/Operator Information

Aircraft Manufacturer:	CESSNA	Registration:	N2209G
Model/Series:	182A A	Aircraft Category:	Airplane
Year of Manufacture:		Amateur Built:	No
Airworthiness Certificate:	Normal	Serial Number:	51509
Landing Gear Type:	Tricycle	Seats:	
Date/Type of Last Inspection:		Certified Max Gross Wt.:	2348 lbs
Time Since Last Inspection:		Engines:	1 Reciprocating
Airframe Total Time:		Engine Manufacturer:	CONT MOTOR
ELT:	Not installed	Engine Model/Series:	O-470 SERIES
Registered Owner:	QUAD CITY SKYDIVING CENTER INC	Rated Power:	0 hp
Operator:	QUAD CITY SKYDIVING CENTER INC	Air Carrier Operating Certificate:	None

Meteorological Information and Flight Plan

Observation Facility, Elevation:		Observation Time:	
Distance from Accident Site:		Condition of Light:	Day
Direction from Accident Site:		Conditions at Accident Site:	Visual Conditions
Lowest Cloud Condition:		Temperature/Dew Point:	
Lowest Ceiling:		Visibility	
Wind Speed/Gusts, Direction:		Visibility (RVR):	
Altimeter Setting:		Visibility (RVV):	
Precipitation and Obscuration:			
Departure Point:	Geneseo, IL (3G8)	Type of Flight Plan Filed:	
Destination:	Geneseo, IL (3G8)	Type of Clearance:	None
Departure Time:	CDT	Type of Airspace:	

Airport Information

Airport:	Geneseo Airpark (3G8)	Runway Surface Type:	Grass/turf
Airport Elevation:	645 ft	Runway Surface Condition:	
Runway Used:	27	IFR Approach:	None
Runway Length/Width:	2568 ft / 120 ft	VFR Approach/Landing:	Full Stop

Wreckage and Impact Information

Crew Injuries:	1 Minor	Aircraft Damage:	Substantial
Passenger Injuries:	N/A	Aircraft Fire:	None
Ground Injuries:	N/A	Aircraft Explosion:	None
Total Injuries:	1 Minor		

Administrative Information

Investigator In Charge (IIC):	Leah D Yeager	Adopted Date:	09/24/2014
Additional Participating Persons:			
Publish Date:	09/25/2015		
Note:	This accident report documents the factual circumstances of this accident as described to the NTSB.		
Investigation Docket:	http://dms.nts.gov/pubdms/search/dockList.cfm?mKey=89668		

The National Transportation Safety Board (NTSB), established in 1967, is an independent federal agency mandated by Congress through the Independent Safety Board Act of 1974 to investigate transportation accidents, determine the probable causes of the accidents, issue safety recommendations, study transportation safety issues, and evaluate the safety effectiveness of government agencies involved in transportation. The NTSB makes public its actions and decisions through accident reports, safety studies, special investigation reports, safety recommendations, and statistical reviews.

The Independent Safety Board Act, as codified at 49 U.S.C. Section 1154(b), precludes the admission into evidence or use of any part of an NTSB report related to an incident or accident in a civil action for damages resulting from a matter mentioned in the report.