



# National Transportation Safety Board Aviation Accident Final Report

---

<b>Location:</b>	Willow Springs, MO	<b>Accident Number:</b>	CEN14CA532
<b>Date &amp; Time:</b>	09/01/2014, 0650 CDT	<b>Registration:</b>	N2017A
<b>Aircraft:</b>	AIRBORNE EDGE X	<b>Aircraft Damage:</b>	Substantial
<b>Defining Event:</b>	Windshear or thunderstorm	<b>Injuries:</b>	2 Minor
<b>Flight Conducted Under:</b>	Part 91: General Aviation - Personal		

---

## Analysis

The pilot stated that, about 45 minutes before departure, he obtained the current weather conditions via an internet website and observed a thunderstorm located about 100 miles west of the departure airport. About 20 minutes into the local area flight, he recalled seeing a low cloud bank, with a base of about 1,000 feet above ground level (agl), about 1/4 mile east of the airport. At the same time, he noticed an area of heavy rain from clouds located about 15 miles west of his position. He decided to land as soon as possible due to the deteriorating weather. Instead of making an approach to the airport's single runway, he decided to land toward the west in an open pasture area that was located on the airport property. Shortly after clearing trees and hangars that were located on the east side of the airport, the weight-shift-control aircraft suddenly lost altitude, from about 20 feet agl, and impacted the ground in an upright attitude. After the impact, the aircraft rolled over onto its left side. The pilot reported that the aircraft did not appear to have any forward velocity when it impacted terrain, as indicated by a lack of damage to the surrounding vegetation. The aircraft sustained substantial damage to the wing and fuselage. He stated that there were no mechanical malfunctions of the aircraft that would have precluded normal operation. Additionally, he reported that the aircraft's operating limitations included a maximum headwind and crosswind component of 21 knots and 11 knots, respectively.

Meteorological data collected during the accident investigation indicated that, at the time of the accident, there was a squall line of strong-to-severe thunderstorms within a few miles of the accident site. Local weather stations indicated that there was a wind shift from the south to the north that was associated with the passage of the frontal boundary. The weather stations also reported wind gusts reaching 24 knots. A review of weather radar imagery indicated that, at the time of the pilot's preflight weather check, there was a line of thunderstorms located about 40 miles northwest of the departure airport. The same line of thunderstorms was within a few miles of the airport at the time of the accident and moved through the area almost immediately thereafter. The meteorological data suggested that the aircraft likely encountered a gust front that was associated with approaching line of thunderstorms. Although the pilot checked the weather before departure, his failure to correctly identify the location and speed of the approaching line of thunderstorms contributed to the low-level wind shear encounter

shortly before touchdown.

## Probable Cause and Findings

The National Transportation Safety Board determines the probable cause(s) of this accident to be: The pilot's loss of control after the weight-shift-control aircraft encountered low-level wind shear shortly before touchdown. Also causal to the accident was the pilot's inadequate preflight weather assessment that failed to correctly determine the actual location and speed of the approaching line of thunderstorms.

### Findings

<b>Personnel issues</b>	Weather planning - Pilot (Cause) Identification/recognition - Pilot (Cause)
<b>Environmental issues</b>	Windshear - Ability to respond/compensate (Cause)

## Factual Information

### History of Flight

Prior to flight	Preflight or dispatch event
Landing	Windshear or thunderstorm (Defining event) Loss of control in flight Collision with terr/obj (non-CFIT)

### Pilot Information

Certificate:	Sport Pilot	Age:	67
Airplane Rating(s):	None	Seat Occupied:	Front
Other Aircraft Rating(s):	None	Restraint Used:	
Instrument Rating(s):	None	Second Pilot Present:	No
Instructor Rating(s):	None	Toxicology Performed:	No
Medical Certification:	Sport Pilot None	Last Medical Exam:	
Occupational Pilot:	No	Last Flight Review or Equivalent:	10/24/2012
Flight Time:	496 hours (Total, all aircraft), 356 hours (Total, this make and model), 466 hours (Pilot In Command, all aircraft), 7 hours (Last 90 days, all aircraft), 2 hours (Last 30 days, all aircraft), 1 hours (Last 24 hours, all aircraft)		

### Aircraft and Owner/Operator Information

Aircraft Manufacturer:	AIRBORNE	Registration:	N2017A
Model/Series:	EDGE X	Aircraft Category:	Weight-Shift
Year of Manufacture:		Amateur Built:	No
Airworthiness Certificate:	Experimental Light Sport	Serial Number:	582-587
Landing Gear Type:	Tricycle	Seats:	2
Date/Type of Last Inspection:	04/14/2014, Conditional	Certified Max Gross Wt.:	882 lbs
Time Since Last Inspection:		Engines:	1 Reciprocating
Airframe Total Time:	431 Hours	Engine Manufacturer:	Rotax
ELT:	Not installed	Engine Model/Series:	582
Registered Owner:	On file	Rated Power:	65 hp
Operator:	On file	Air Carrier Operating Certificate:	None

## Meteorological Information and Flight Plan

Observation Facility, Elevation:	UNO, 1228 ft msl	Observation Time:	0653 CDT
Distance from Accident Site:	7 Nautical Miles	Condition of Light:	Day
Direction from Accident Site:	160°	Conditions at Accident Site:	Visual Conditions
Lowest Cloud Condition:	Scattered / 6000 ft agl	Temperature/Dew Point:	22° C / 21° C
Lowest Ceiling:	None	Visibility	10 Miles
Wind Speed/Gusts, Direction:	5 knots, 200°	Visibility (RVR):	
Altimeter Setting:	30.02 inches Hg	Visibility (RVV):	
Precipitation and Obscuration:	No Obscuration; No Precipitation		
Departure Point:	Willow Springs, MO (1H5)	Type of Flight Plan Filed:	None
Destination:	Willow Springs, MO (1H5)	Type of Clearance:	None
Departure Time:	0630 CDT	Type of Airspace:	Class G

## Airport Information

Airport:	Willow Springs Memorial (1H5)	Runway Surface Type:	Grass/turf
Airport Elevation:	1247 ft	Runway Surface Condition:	Dry; Vegetation
Runway Used:	N/A	IFR Approach:	None
Runway Length/Width:		VFR Approach/Landing:	Precautionary Landing

## Wreckage and Impact Information

Crew Injuries:	1 Minor	Aircraft Damage:	Substantial
Passenger Injuries:	1 Minor	Aircraft Fire:	None
Ground Injuries:	N/A	Aircraft Explosion:	None
Total Injuries:	2 Minor		

## Administrative Information

Investigator In Charge (IIC):	Andrew T Fox	Adopted Date:	04/07/2015
Additional Participating Persons:	Samuel Cochran; Federal Aviation Administration, St. Louis FSDO; St. Ann, MO Harvinder Pujji; Federal Aviation Administration, St. Louis FSDO; St. Ann, MO		
Publish Date:	04/07/2015		
Note:	This accident report documents the factual circumstances of this accident as described to the NTSB.		
Investigation Docket:	<a href="http://dms.nts.gov/pubdms/search/dockList.cfm?mKey=90399">http://dms.nts.gov/pubdms/search/dockList.cfm?mKey=90399</a>		

The National Transportation Safety Board (NTSB), established in 1967, is an independent federal agency mandated by Congress through the Independent Safety Board Act of 1974 to investigate transportation accidents, determine the probable causes of the accidents, issue safety recommendations, study transportation safety issues, and evaluate the safety effectiveness of government agencies involved in transportation. The NTSB makes public its actions and decisions through accident reports, safety studies, special investigation reports, safety recommendations, and statistical reviews.

The Independent Safety Board Act, as codified at 49 U.S.C. Section 1154(b), precludes the admission into evidence or use of any part of an NTSB report related to an incident or accident in a civil action for damages resulting from a matter mentioned in the report.