



National Transportation Safety Board Aviation Accident Final Report

Location:	Des Moines, IA	Accident Number:	CEN16LA320
Date & Time:	08/13/2016, 1001 CDT	Registration:	N314BF
Aircraft:	CIRRUS DESIGN CORP SR20	Aircraft Damage:	Destroyed
Defining Event:	Loss of engine power (partial)	Injuries:	3 Minor, 1 None
Flight Conducted Under:	Part 91: General Aviation - Personal		

Analysis

The pilot and three passengers departed on a personal cross-country flight when the pilot heard and felt a sudden reduction in engine power during initial climb. He told the tower controller that he had engine trouble and requested an immediate landing. The pilot was unable to maintain altitude and, as a result, deployed the airplane's emergency parachute system. After a successful parachute deployment, the airplane contacted power lines shortly before it impacted the ground in a nose-level attitude. After the airplane landed, the occupants egressed, and a fire erupted that destroyed the airframe.

A postaccident engine examination revealed that the induction tube coupler closest to the No. 1 cylinder was partially disconnected from its associated induction tube. Although both coupler clamps were tight, the clamp closest to the No. 1 cylinder did not overlap its associated induction tube. Additionally, the cylinder No. 3 induction tube was fractured at the cylinder mounting flange. A laboratory examination of the cylinder No. 3 induction tube revealed multiple areas of fatigue; however, the cause of the fatigue could not be conclusively determined due to postfracture damage. The material properties of the induction tube were consistent with the manufacturer's specification for an annealed aluminum alloy. A review of the engine logbook was inconclusive as to whether the induction system tubes had been removed for maintenance in the 7.4 years since the engine had been rebuilt. The two separations in the induction system likely caused an imbalance of the intake pressures and the partial loss of engine power during initial climb.

Probable Cause and Findings

The National Transportation Safety Board determines the probable cause(s) of this accident to be:

The two separations in the induction system due to improper installation and/or maintenance, which resulted in a partial loss of engine power during initial climb.

Findings

Aircraft	Recip eng cyl section - Failure (Cause) Recip eng cyl section - Incorrect service/maintenance (Cause)
Environmental issues	Wire - Contributed to outcome

Factual Information

On August 13, 2016, about 1001 central daylight time, a Cirrus Design Corporation SR20 airplane, N314BF, had a partial loss of engine power shortly after takeoff from Des Moines International Airport (DSM), Des Moines, Iowa. The pilot deployed the Cirrus Airframe Parachute System (CAPS) and descended into power lines and terrain. The airplane was subsequently destroyed by a postimpact fire. The pilot and 2 passengers sustained minor injuries. An additional passenger was not injured. The airplane was operated as a Title 14 *Code of Federal Regulations* Part 91 personal flight.

The pilot reported that he did not observe any airframe or engine anomalies during his preflight inspection. He also noted that the fuel tanks were completely full, and that he did not observe any contamination in the fuel samples that he obtained during his preflight inspection. The pilot reported that the engine started without hesitation and idled normally before taxi, and that he did not observe any anomalies during his before takeoff engine run-up.

A normal takeoff was made on runway 31 from the taxiway Romeo intersection with the wing flaps set at 50%, the electric fuel pump selected to boost, and the mixture-control set to full rich. The pilot reported that the engine instrumentation indicated normal readings during the takeoff run and that liftoff was achieved at 70 knots indicated airspeed (KIAS). After liftoff, the pilot reduced airplane pitch and accelerated to 90-95 KIAS before he retracted the wing flaps. The pilot reported that during the initial climb, about 500 ft above ground level (agl), he heard and felt a sudden reduction in engine power. He told the tower controller that he had engine trouble and requested an immediate landing. The tower controller cleared the pilot to enter a right downwind for landing on runway 31. The pilot reported that he was unable to maintain altitude and, as a result, he deployed the CAPS. After a successful parachute deployment, the airplane contacted power lines shortly before it impacted the ground at the intersection of Park Avenue and SW 56th Street. The pilot remarked that the airplane had landed "remarkably soft" in a nose level attitude. After landing, a fire erupted from under the left wing and the pilot told his passengers to evacuate from the right cabin door. The airplane was subsequently destroyed by the postimpact fire.

The airplane was a four-place single engine low-wing airplane of primarily composite construction. The airplane was powered by a 6-cylinder, 200 horsepower, Continental Motors IO-360-ES16B engine, serial number 1000059, which drove a two-blade Hartzell model BHC-J2YF-1BF/F7694 constant speed propeller. According to airplane logbook entries, the most recent annual inspection was completed on May 19, 2016, at 1,565.6 hours total airframe time. As of the annual inspection, the engine had accumulated 555.1 hours since it was rebuilt at the factory on March 20, 2009. A review the engine logbook only revealed one maintenance entry, dated February 10, 2012, at 181.5 hours total engine time, in which the induction system was specifically mentioned as having been inspected. However, further review the engine logbook was inconclusive if the induction system tubes had been removed for maintenance in the 7.4 years since the engine had been rebuilt. According to the pilot, the airplane had accumulated about 66.5 flight hours since the last annual inspection.

The engine and propeller were not damaged by the postimpact fire. The engine remained attached to the firewall and the propeller remained attached to the crankshaft flange. The propeller exhibited torsional twisting, S-shaped spanwise bends, leading edge damage, and burnishing of the blade face and back. Internal engine and valve train continuity was confirmed as the engine crankshaft was rotated. Compression and suction were observed on all cylinders in conjunction with crankshaft rotation, and both magnetos provided spark at all leads. The sparkplugs for cylinder Nos. 4 and 5 exhibited excessive black soot, consistent with an over-rich fuel/air mixture. The remaining sparkplugs exhibited features consistent with normal engine operation. A borescope inspection of each cylinder did not reveal any anomalies. Additionally, no anomalies were observed with the fuel servo, mechanical fuel pump, fuel flow divider, or fuel injectors. A disassembly of the oil filter did not reveal any metal debris. The induction tube coupler closest to the No. 1 cylinder, part number (p/n) 654439-16, was observed partially disconnected from its associated induction tube. Although both coupler clamps were tight, the clamp, p/n AN737TW74, closest to the No. 1 cylinder did not overlap its associated induction tube. Additionally, the cylinder No. 3 induction tube, p/n 655224-1, was fractured at the cylinder mounting flange.

The fractured No. 3 induction tube, p/n 655224-1, was submitted to the National Transportation Safety Board (NTSB) Materials Laboratory for additional examination. A visual examination confirmed that the mounting flange of the induction tube had fractured from the main body of the tube. An additional attachment flange that had been installed between the induction tube flange and the engine cylinder did not exhibit any discernible damage. Several measurements of the induction tube revealed it was deformed in multiple directions such that the measurements at various locations produced inconsistent data. The tube inner diameter measured 1.624 inches, and the outer diameter measured between 1.742 and 1.767 inches. The tube thickness ranged between 0.705 and 0.735 inches. The manufacturer drawing dimension AB measured 2.822 inches, and the AC line measured about 2.6 inches. The fracture between the flange and the remaining tube was circumferential in orientation and perpendicular to the tube direction. The flange had also fractured in two additional locations longitudinally, creating two flange fragments. In general, the mating fracture surfaces exhibited a flat orientation, with some other areas exhibiting a 45° fracture orientation. The fracture surfaces exhibited smearing and rub marks, consistent with post-fracture damage. Examination of the flange-side fracture surface with a scanning electron microscope revealed fatigue striations, consistent with fatigue crack propagation. The character and spacing of the striations were consistent with high-cycle fatigue. The likely initiation sites of the fatigue had been destroyed by the post-fracture smearing. The chemical composition of the fractured induction tube flange was determined by energy dispersive x-ray spectroscopy (EDS) and was consistent with an AA 6061-series aluminum alloy. The results of material electrical conductivity and hardness testing were consistent with those typical of the 6061-O aluminum alloy in the annealed condition. The chemical composition, electrical conductivity, and hardness values were consistent with the engine manufacturer's part specification.

History of Flight

Initial climb	Powerplant sys/comp malf/fail Loss of engine power (partial) (Defining event) Miscellaneous/other
Landing	Off-field or emergency landing Collision with terr/obj (non-CFIT)
Post-impact	Fire/smoke (post-impact)

Pilot Information

Certificate:	Private	Age:	42, Male
Airplane Rating(s):	Single-engine Land	Seat Occupied:	Left
Other Aircraft Rating(s):	None	Restraint Used:	
Instrument Rating(s):	Airplane	Second Pilot Present:	No
Instructor Rating(s):	None	Toxicology Performed:	No
Medical Certification:	Class 3 Without Waivers/Limitations	Last FAA Medical Exam:	02/08/2013
Occupational Pilot:	No	Last Flight Review or Equivalent:	03/23/2016
Flight Time:	(Estimated) 252 hours (Total, all aircraft), 66 hours (Total, this make and model), 211 hours (Pilot In Command, all aircraft), 66 hours (Last 90 days, all aircraft), 37 hours (Last 30 days, all aircraft), 0 hours (Last 24 hours, all aircraft)		

Aircraft and Owner/Operator Information

Aircraft Make:	CIRRUS DESIGN CORP	Registration:	N314BF
Model/Series:	SR20 NO SERIES	Aircraft Category:	Airplane
Year of Manufacture:	2000	Amateur Built:	No
Airworthiness Certificate:	Normal	Serial Number:	1055
Landing Gear Type:	Tricycle	Seats:	4
Date/Type of Last Inspection:	05/19/2016, Annual	Certified Max Gross Wt.:	3000 lbs
Time Since Last Inspection:	66 Hours	Engines:	1 Reciprocating
Airframe Total Time:	1632 Hours at time of accident	Engine Manufacturer:	Continental
ELT:	Installed, not activated	Engine Model/Series:	IO-360-ES16B
Registered Owner:	Alidade Partners, LLC	Rated Power:	200 hp
Operator:	Alidade Partners, LLC	Operating Certificate(s) Held:	None

Meteorological Information and Flight Plan

Conditions at Accident Site:	Visual Conditions	Condition of Light:	Day
Observation Facility, Elevation:	DSM, 958 ft msl	Distance from Accident Site:	2 Nautical Miles
Observation Time:	0954 CDT	Direction from Accident Site:	130°
Lowest Cloud Condition:	Clear	Visibility	10 Miles
Lowest Ceiling:	None	Visibility (RVR):	
Wind Speed/Gusts:	8 knots /	Turbulence Type Forecast/Actual:	None / None
Wind Direction:	350°	Turbulence Severity Forecast/Actual:	N/A / N/A
Altimeter Setting:	29.97 inches Hg	Temperature/Dew Point:	25° C / 18° C
Precipitation and Obscuration:	No Obscuration; No Precipitation		
Departure Point:	Des Moines, IA (DSM)	Type of Flight Plan Filed:	IFR
Destination:	Lebanon, OH (I68)	Type of Clearance:	IFR
Departure Time:	1001 CDT	Type of Airspace:	Class C

Airport Information

Airport:	Des Moines International Arpt (DSM)	Runway Surface Type:	Asphalt; Concrete
Airport Elevation:	958 ft	Runway Surface Condition:	Dry
Runway Used:	31	IFR Approach:	None
Runway Length/Width:	9002 ft / 150 ft	VFR Approach/Landing:	Forced Landing

Wreckage and Impact Information

Crew Injuries:	1 Minor	Aircraft Damage:	Destroyed
Passenger Injuries:	2 Minor, 1 None	Aircraft Fire:	On-Ground
Ground Injuries:	N/A	Aircraft Explosion:	None
Total Injuries:	3 Minor, 1 None	Latitude, Longitude:	41.555556, -93.691389

Administrative Information

Investigator In Charge (IIC):	Andrew T Fox	Report Date:	06/08/2020
Additional Participating Persons:	Josh M Rohrer; Federal Aviation Administration, Des Moines FSDO; Ankeny, IA Brannon Mayer; Cirrus Aircraft; Duluth, MN Kurt Gibson; Continental Motors Group; Mobile, AL		
Publish Date:	06/08/2020		
Note:	The NTSB did not travel to the scene of this accident.		
Investigation Docket:	http://dms.nts.gov/pubdms/search/dockList.cfm?mKey=93827		

The National Transportation Safety Board (NTSB), established in 1967, is an independent federal agency mandated by Congress through the Independent Safety Board Act of 1974 to investigate transportation accidents, determine the probable causes of the accidents, issue safety recommendations, study transportation safety issues, and evaluate the safety effectiveness of government agencies involved in transportation. The NTSB makes public its actions and decisions through accident reports, safety studies, special investigation reports, safety recommendations, and statistical reviews.

The Independent Safety Board Act, as codified at 49 U.S.C. Section 1154(b), precludes the admission into evidence or use of any part of an NTSB report related to an incident or accident in a civil action for damages resulting from a matter mentioned in the report. A factual report that may be admissible under 49 U.S.C. § 1154(b) is available [here](#).